



## Кюсера FS-4300 ошибка 7900.

Опубликовал *copypop* , 04/10/2018 - 12:15

Темы:

- [Сервис копировальной техники](#)

? ?????? ?????? ???? ?????????? ?? ?????? 7900 ? ?????????? Kyocera 4300.

Звучит эта ошибка следующим образом::

Drum unit EEPROM error. No response is issued from the device in reading/writing for 5 ms or more and this problem is repeated five times successively. Mismatch of reading data from two locations occurs eight times successively. Mismatch between writing data and reading data occurs eight times successively.	
--	--

В нашем случае появление ошибки было связано с открыванием лотка с бумагой в момент, когда принтер получал информацию на печать.

Штатные попытки скинуть ошибку результата не давали, на дисплее отображалась информация про ошибку и на клавиши принтер не реагировал.

Множество информации в интернете про пути решения проблемы 100% гарантированного результата не дают. А это и замена ремкомплекта, и перепрошивка аппарата, и проверка всех проводов и коннекторов.

В нашем случае помогло решить проблему снятие элемента питания с главной платы. После повторной установки отобразилась ошибка 0840, которая легко снялась комбинацией клавиш «Красная» и «Сброс».

В тоже время не стоит полагаться на то, что данный способ панацея от данной ошибки. Это лишь частный случай решения проблемы. В практике же рекомендую любой сервис доверить квалифицированному инженеру.

- [Сервис копировальной техники](#)

Оригинал : <https://old.copypop.com.ua/blog/333.html>